



Operating Manual ()



Electronic Pressure Switch DS 2XX

DS 200, DS 200 P. DS 201, DS 201 P. DS 202. DS 210, DS 214, DS 217, DS 233



DS 200

www.bdsensors.com

Eastern Europe

Hradištská 817

Czech Republic

China

China

BD SENSORS e r o

CZ - 687 08 Buchlovice

Tel.: +42 (0) 572-4110 11

Fax: +42 (0) 572-4114 97

No. 1188 Lianhang Rd.

201112 Shanghai

BD SENSORS China Co. Ltd.

Tel.: +86 (0) 21-51600 190

ASIA

India

• Iran

Israel

Japan

Kazakhstan

Malaysia

Singapore

Taiwan

Thailand

Vietnam

Fax: +86 (0) 21-33600 613

Room B. 2nd Floor, Building 10.

Headquarters BD SENSORS GmbH

BD-Sensors-Str. 1 D - 95199 Thierstein Tel.: +49 (0) 9235-9811-0 Fax: +49 (0) 9235-9811-11

Russia BD SENSORS BUS

39a. Varshavskoe shosse BU - Moscow 117105

Russia Tel.: +7 (0) 95-380 1683 Fax: +7 (0) 95-380 1681

further agencies in:

EUROPE

•	Belgium
•	Denmark
•	Finland
•	France
•	Great Brit
•	Greece
•	Italy
•	Lithuania

 Turkev IIK I lkraine Luxembura

 Netherlands Norway Poland Portugal

Eavpt

AFRICA

Romania

Sweden

Slovakia

Spain

Switzerland

South Africa

AUSTRALIA

The addresses of our distribution partners are listed on our homepage www.bdsensors.com. It is possible to download data sheets, operating manuals, ordering codes and certificates, as well

1 General information

1.1 Information on the operating manual

This operating manual contains important information on proper usage of the device. Read this operating manual carefully before installing and starting up the pressure mageuring davice

Adhere to the safety notes and operating instructions which are given in the operating manual. Additionally applicable regulations regarding occupational safety, accident prevention as well as national installation standards and engineer ing rules must be complied with!

This operating manual is part of the device, must be kept nearest its location, always accessible to all employees.

- Technical modifications reserved -

1.2 Symbols used

- DANGER! dangerous situation, which may result in
- WARNING! potentially dangerous situation, which may result in death or serious injuries
- CAUTION! potentially dangerous situation, which may result in minor injuries
- ! CAUTION! potentially dangerous situation, which may result in physical damage
- NOTE tips and information to ensure a failure-free operation

1.3 Target group

⚠ WARNING! To avoid operator hazards and damages of the device, the following instructions have to be worked out by qualified technical personnel

1.4.Limitation of liability

By non-observance of the operating manual, inappropriate use, modification or damage, no liability is assumed and warranty claims will be excluded.

- The electronic pressure switch DS 2XX has been developed, according to the type for applications, for absolute, vacuum and overpressure measurement. It is equipped with a 4-digit LED-display to show the current system pressure. Depending on the device and the mechanical connection it is suitable for various areas of use. It is the operator's responsibility to check and verify the suitability of the device for the intended application If any doubts remain, please contact our sales depart ment in order to ensure proper usage. BD SENSORS is not liable for any incorrect selections and their effects!
- Permissible media are gases or liquids, which are compatible with the media wetted parts described in the data sheet. In addition it has to be ensured, that this medium is compatible with the media wetted parts.
- The technical data listed in the current data sheet are engaging. If the data sheet is not available, please order or download it from our homepage. (http://www.bdsensors.com)

⚠ WARNING! – Danger through improper usage!

1.6 Package contents

Please verify that all listed parts are undamaged included in the delivery and check for consistency specified in your

- electronic pressure switch, series DS 2XX
- for mechanical pressure ports DIN 3852: o-ring (pre-assembled)
- mounting instructions

2. Product identification

The device can be identified by its manufacturing label. It provides the most important data. By the ordering code the product can be clearly identified. The programme version of the firmware, (e. g. P07) will appear for about 1 second in the display after starting up the device. Please hold it ready for inquiry calls.

 


Fig. 1 manufacturing label

! The manufacturing label must not be removed from the device

3. Mechanical installation

3.1 General mounting and safety instructions

⚠ WARNING! Install the device only when depressurized

- ⚠ WARNING! This device may only be installed by qualified technical personnel who has read and understood the operating manual
- ! Handle this high-sensitive electronic precision measuring device with care, both in packed and unpacked condition!
- ! There are no modifications/changes to be made on the
- ! Do not throw the package/device!
- ! To avoid damaging the diaphragm, remove packaging and protective cap only directly before starting up the device. A delivered protective cap must be stored
- ! Place the protective cap on the pressure port again immediately after disassembling
- ! Handle the unprotected diaphragm very carefully it is very sensitive and may be easily damaged
- ! Do not use any force when installing the device to prevent damage of the device and the pla
- ! The display and the plastic housing are equipped with rotational limiters. Please do only rotate the display or the housing within the limit.
- ! For installations outdoor and in damp areas following these instructions:
- To prevent moisture admission in the plug the device should be installed electrically after mounting at once. Otherwise a moisture admission has to be blocked e.g. by using a suitable protection cap. (The ingress protection in the data sheet is valid for the connected device.)
- Choose an assembly position, which allows the flow-off of splashed water and condensation. Avoid permanent fluid at sealing surfaces!
- When using a cable gland device, turn the outgoing cable downwards. If the cable has to be turned upwards, then point it downward so the moisture can drain
- Install the device in such a way that it is protected from direct solar irradiation. Direct solar irradiation can lead to the permissible operating temperature being overstepped in the worst case. By this the operability of the device can be affected or damaged. If the internal pressure increases due to solar irradiation, measurement errors may be caused.
- ! For devices with gauge reference in the housing (small hole next to the electrical connection), install the device in such a way, that the gauge reference is protected from dirt and moisture. Should the device be exposed to fluid admission, the functionality will be blocked by the gauge reference. An exact measurement in this condition is not possible. Furthermore this can lead to damages on the device
- Take note that no inadmissibly high mechanical stresses occur at the pressure port as a result of the installation, since this may cause a shifting of the characteristic curve or to the demage. This is especially important for very small pressure ranges as well as for devices with a pressure port made of plastic.
- In hydraulic systems, position the device in such a way that the pressure port points unward (ventilation)
- Provide a cooling line when using the device in steam pipina.
- In If installing the device outdoor and there is any danger of lightning or overpressure we suggest putting a overpressure protection unit between the supply/switch cabinet and the device to prevent damage.
- If the device is installed with the pressure connection up, it has to be made sure that no liquid drain off at the case. Humidity and dirt can block the relative cover in the case and it could lead to malfunctions through this. Dust and dirt must be removed from the edge of the thread connection of the electrical connection if re-

3.2 Mounting and eafety instructions gyvgen

- ▲ DANGER! Explosion hazard, with devices for oxygen applications, when used improperly. To ensure a usage without danger, the following points must be adhered to
 - Make sure, your device has been ordered and delivered as a special version for ovugen applications. You can check the manufacturing label (see figure 1). If the ordering code ends with "007", then the device is suitable for oxygen applications.
 - At time of delivery the device is packed into a plastic bag in order to prevent it from impurity. Please observe the indication label "Device for oxygen, unpack only directly before assembling". Also, avoid any skin contacts during unpacking and assembly, in order to prevent greasy residues on the device
 - During installation, the respective explosion protection regulations have to be met. Check, if ATEXapproval is necessary for this type (oxygen) device. (the delivered device has no ATEX-approval)
 - Note the entire design requirements meet the standard demand of BAM (DIN 19247).
 - For oxygen applications over 25 har are recommended pressure transmitter without seals.
 - Transmitters with o-rings of FKM Vi 567: permissible maximum values: 25 bar / 150° C (RAM approval)

3.3 General installation steps

3.4 Installation steps for DIN 3852

- Carefully remove the pressure measuring device from the package and dispose of the package properly
- Go ahead as detailed in the specific instructions below

⚠ DO NOT USE ANY ADDITIONAL SEALING MATERI-ALS, LIKE YARN, HEMP OR TEFLON TAPE!

- Check to ensure the proper groove fitting of the o-ring and additionally to ensure no damage to the o-ring.
- Ensure that the sealing surface of the taking part is perfectly smooth and clean. (Rz 3.2)
- Screw the device into the corresponding thread by
- If you have a device with a knurled ring, the transmitter has to be screwed in by hand only
- Devices with a spanner flat have to be tightened with an open-end wrench (wrench size of steel: G1/4": approx. 5 Nm; G1/2": approx. 10 Nm; G3/4": approx. 15 Nm G1": approx. 20 Nm: wrench size of plastic: max. 3 Nm).
- The indicated tightening torques must not be

3.5 Installation steps for EN 837

- Use a suitable seal, corresponding to the medium and the pressure input (e. g. a cooper gasket)
- Ensure that the sealing surface of the taking part is perfectly smooth and clean. (Rz 6.3)
- Screw the device into the corresponding thread by
- Tighten it with a wrench (for G1/4": approx. 20 Nm; for G1/2": approx. 50 Nm) The indicated tightening torques must not be

- 3.6 Installation steps for NPT
- Use a suitable seal (e. g. a PTFE-strip). Screw the device into the corresponding thread by
- Tighten it with a wrench (for 1/4" NPT: approx. 30 Nm: for 1/2" NPT: approx. 70 Nm)
- The indicated tightening torques must not be

3.7 Installation steps for dairy pipe

- Check to ensure that the O-ring fits properly into the intended groove in the mounting part.
- Centre the dairy pipe connection in the counterpart.
- Screw the cup nut onto the mounting part. - Then tighten it with a hook wrench.

3.8 Installation stone for Clamp and Variyent®

- Use a suitable seal corresponding to the medium and the pressure input.
- Put the seal onto the corresponding mounting part
- Centre the Clamp or Varivent®connection on the fitting
- Then fit the device with a suitable fastening element (e. g. semi-ring or retractable ring clamp) according to

3.9 Installation steps for internal threads M20x1.5 and

- Screw the high pressure connection into the internal thread of the DMP 334 and tighten it properly with approx 160 Nm
- ⚠ DANGER! The high pressure tube seals metalto-metal in the chamfer of the pressure port. No further seal is allowed with this high pressure connection. A wrong installation can cause enormous danger!

3 10 Installation stens for DS 233

the supplier's instructions.

- Connect the reference pressures so that the higher pressure is connected with input "p+" and the lower pressure is connected with input "p-
- Fix the device according to your demands on the holder or holding angle intended for it. For mounting the device mounting threads or holes are provided
- The indicated tightening torques must not be exceeded!

Installation steps with G 1/8" internal thread

- Seal the pressure ports of the differential pressure transmitter in a way that is suitable for your application (Seals are not included in the scope of delivery.)
- Screw the fittings into the threads as far as possible and tighten them properly (max. 10 Nm)

Installation steps with tube nozzle Ø 6.6 x 11

Slip your flexible tubes (Ø 6 mm) onto the tube nozzles as far as possible

3.11 Positioning of the display module

The display module is rotatable so that clear readability is guaranteed even on unusual installation positions. The display module can be turned as shown below





Fia. 2 display module

Pin configuration


4. Electrical installation ⚠ WARNING! Install the device only when depressurized

and currentless! Establish the electrical connection of the device according to the technical data shown on the manufacturing label, the pin configuration and the wiring diagram.

•	iii comigaration				
	Electrical connections	M12x1 plastic (5-/8-pin)	M12x1 metal (5-pin)	ISO 4400	cable colours (DIN 47100)
Γ	Supply +	1	1	1	wh (white)
ı	Supply -	3	3	2	bn (brown)
ı	3-wire: Signal +	2	2	3	gn (green)
ı	Contact 1	4	4	3	gr (grey)
ı	Contact 2	5	5	-	pn (pink)
ı	Contact 3	6 1	-	-	-
ı	Contact 4	7 1	-	-	-
	Shield	via pressure port	plug- housing/ pressure port	ground contact	gn/ye (green/ yellow)


¹ for 8-pin plug

 Wiring diagrams





contact 1

 

- ! For devices with cable gland as well as cable socket, you have to make sure that the external diameter of the used cable is within the allowed clamping range. Moreover you have to ensure that it lies in the cable gland firmly and cleftlessly!
- ! For the installation of a device with cable outlet following hending radiuses have to be complied with: cable without ventilation tube:
- static installation: 5-fold cable diameter dynamic application: 10-fold cable diameter cable with ventilation tube.
- static installation: 10-fold cable diameter dynamic application; 20-fold cable diameter
- ! Please note for devices with ISO 4400 plug and cable socket, that the socket has to be mounted properly to ensure the ingress protection mentioned in the data sheet. Please check if the delivered seal is placed between plug and cable socket. After connecting the cable fasten the cable socket on the device by using the
- ! Prevent the damage or removal of the PTFE filter which is fixed over the end of the air tube on devices with cable outlet and integrated air tube
- For the electrical connection a shielded and twisted multicore cable is recommended.
- IN If a transition is desired from a transmitter cable with gauge tube to a cable without gauge tube, we recommend our terminal box KL 1 or KL 2

5. Initial start-up

- Before start-up, the user has to check for proper installation and for any visible defects
- The device can be started and operated by authorized personnel only, who have read and understood the operating manual
- The device has to be used within the technical specifications, only! (check the technical data in the data

6 Operation

6.1 Operating and display elements

 


Fig. 3 touchpad for device with two contacts

The device has, according to the order max. four LEDs which are allocated to the resp. contacts. The LEDs will light up when the respective set point has been reached and the contact is active. The display of the measured value as well as the configuration of the individual parameters occurs menu-driven via the seven-segment display.

6.2 Configuration

The menu system is a closed system allowing you to scroll both forward and backward through the individual set-up menus to navigate to the desired setting item. All settings are permanently stored in an EEPROM and therefore available again even after disconnecting from the supply voltage. The structure of the menu system is the same for all types of devices, regardless of the number of contacts. However, they only differ by the number of menus. Following figure and the manu list shows all possible manus. On devices with 3-wire output 4 ... 20 mA and 0 ... 20 mA, the menus ZP and EP have special functions. The menu DP is not applied, as the decimal point is already factory set during production.

Please follow the manual meticulously and remember that changes of the adjustable parameters (switch-on point, switch-off point, etc.) become only effective after pushing both buttons simultaneously and leaving the

6.3 Password system

To avoid a configuration by unauthorized persons, the possibility is given to lock the device by an access protection. More information is given in menu 1 of the menu list.

6.4 Configuration example of the analogue output for 4 ... 20 mA / 3-wire adjustable

By the menus ZP and EP, the analogue output can be configured. In the following, the function of these menus shall be made clear by an example. Assuming you have a device with a nominal pressure range 0 ... 400 bar by factory the following

0 bar = 4.00 mA 200 bar = 12.00 mA 400 bar = 20 mA If you change the value in the menu ZP from 0 to 20 and the value in the menu EP from 400 to 300, the following performance will appear

20 bar = 4.00 mA 160 bar = 12.00 mA 300 bar = 20 mA The values of ZP and EP are adjustable up to 1:5 of the nominal pressure range

6.5. Description of hysteresis and compare mode

To invert the respective modes, you have to exchange the values for the switch-on and switch-off points.



 


Fig. 4 compare mode



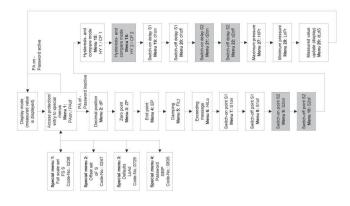





Fig. 7 hysteresis mode inverted

6.6 Structure of the menu system

standard 2-/3-wire-system (version P07)



4 ... 20 mA / 3-wire adjustable (version P07)

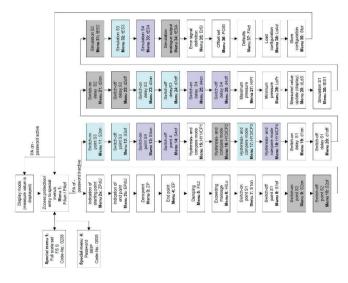

- ▲ -button; move in the menu system (forward) or increase the displayed value; it will also lead you to the operating mode (beginning with menu 1)
- ▼-button: move in the menu system (backward) or decrease the displayed value; it will also lead you to the operating mode (beginning with the last menu)
- both buttons simultaneously: confirm the menu items and set values

to increase the counting speed, when setting the values: keeping the respective button pushed for more than 5 seconds execution of configuration:

- set the desired menu item by pushing the ▲- or ▼-button
- activate the set menu item by pushing both buttons simultaneously set the desired value or select one of the offered settings by using the ▲- or ▼-button
- store/confirm the set value/selected setting and exit the menu by pushing both buttons simultaneously

00	menu 1 – access protection
rnon	PAon → password active → to deactivate: set password PAof → password inactive → to activate: set password
PRoF	
(0)	Redefault setting for the password is "0005"; modification of the password is described in special menu 4
dP -	menu 2 – set decimal point position Fig for devices with 3-wire output 4 20 mA and 0 20 mA the decimal point was already set during production
2P	menus 3 and 4 - set zero point / end point
ĔΡ	the device has been configured correctly before delivery, so a later setting of a 2-wire device is only necessary, if a
CF.	differing displayed value is desired (e. g. 0 100 %) LeTFor devices with 3-wire output 4 20 mA and 0 20 mA this menu has a different meaning: The configura-
	tion of the zero point causes a changing of the analogue output, whereas the display value remains un
	changed. (zero and end point can be configured within the limits of the nominal pressure range, according to
	the manufacturing label); for more information see "5.4 Configuration example of the analogue output for 3 wire-devices"
FILE	menu 5 – set damping
	this function allows getting a constant display value although the measuring values may vary considerably; the time constant for a simulated low-pass filter can be set (0.3 up to 30 sec permissible)
H ILa	menu 6 – exceeding message
11 100	set "on" or "off"
5 lan	menus 7, 9, 11 and 13 – set switch-on points set the particular values, for the activation of contact 1 (S1on) up to 4 (S4on)
SIGF	menus 8, 10, 12 and 14 – set switch-off points
	set the particular values, for the deactivation of contact 1 (S1oF) up to 4 (S4oF)
HA 1	menus 15 up to 18 – select hysteresis or compare mode select the hysteresis mode (HY 1 up to HY 4) or compare mode (CP 1 up to CP 4) for the contacts 1 up to 4
CP ((no. corresponds to the contact)
	© compare "6.5. Description of hysteresis and compare mode" menus 19, 21, 23 and 25 − set switch-on delay
d lan	set the particular value of the switch-on delay after reaching contact 1 (d1on) up to 4 (d4on)
	(0 up to 100 sec permissible)
d loF	menus 20, 22, 24 and 26 – set switch-off delay set the particular value of the delay after reaching the switch-of point 1 (d1oF) up to 4 (d4oF)
	(0 up to 100 sec permissible)
H IPH	menus 27 and 28 – maximum / minimum pressure display
LoPe	view high pressure (HIPr) or low pressure (LoPr) during the measurement process (the value will not remain stored if the power supply is interrupted)
	Is to erase: push both buttons again within one second
dLd5	menu 29– measured value update (display) set the length of the update cycles for the display (0.0 up to 10 sec permissible)
HES 1	menus 30 up to 33 - simulate contacts (only 4 20 mA / 3-wire adjustable)
	with the ▲- or ▼-button the contacts 1 (tES1) up to 4 (tES4) can be activated or deactivated
FFPH	menu 34 – simulate analogue output (only 4 20 mA / 3-wire adjustable) select one of the following settings: "oi 4" (4 mA or 2 V), "oi12" (12 mA or 6 V) and "oi20" (20 mA or 10 V)
E-5,	menu 35 – error signal definition (only 4 20 mA / 3-wire adjustable)
	set the desired error signal (this is given out in case of a defect); permissible settings are "OFF" (no error signal output), "C 0" (0 mA or 0 V), "C L0" (3.5 mA or 1.75 V) and "C HI" (23 mA or 11.5 V)
	Is an output of the error signal is only given when menu 6 is set on "on"
POS 1	menu 36 -offset compensation / position correction (only 4 20 mA / 3-wire adjustable)
	confirm menu item "POSI"; if offset ≠ ambient pressure it is necessary to place the device under pressure pended mounting position (pressure reference has to corresponding to the zero point of the pressure measuring range
	push both buttons; "oF I" will be appeared in the display; push both buttons; in the display "Pro2" will be appeared
	push both buttons; "oF I" will be appeared in the display; push both buttons; in the display "Pro2" will be appeared
	push both buttons; "oF I" will be appeared in the display; push both buttons; in the display "Pro2" will be appeared; push both buttons; in the display "o" will be appeared; now the reference value can be inputted by using bc buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using bc buttons; then push both buttons; in the display "oF5" will be appeared; accordingly the right and stable pressu
	push both buttons; "or I" will be appeared in the display; push both buttons; in the display "Pro2" will be appeared; push both buttons; in the display "o" will be appeared; now the reference value can be inputted by using be buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insent 5 (5%) by using be buttons; then push both buttons; in the display "oF5" will be appeared; accordingly the right and stable pressu (see instance -0.2bar) must be fed. If the measured value shown in the display is a wrong value, the operating the operation of the display is a wrong value, the operating the properties of the display is a wrong value, the operating the properties of the display is a wrong value, the operating the properties of the display is a wrong value, the operating the properties of the display is a wrong value, the operating the properties of the display is a wrong value, the operating the properties of the display is a wrong value, the operating the properties of the display is a wrong value, the operating the properties of the display is a wrong value of the properties of the display is a wrong value.
	push both buttons; "or I" will be appeared in the display; push both buttons; in the display "Pro2" will be appeared; now the reference value can be inputted by using bc buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using bc buttons; then push both buttons; in the display "oF5" will be appeared; accordingly the right and stable pressu (see instance -0.2bar) must be fed. If the measured value shown in the display is a wrong value, the operating sequence must be retreated.
	push both buttons; "for I" will be appeared in the display; push both buttons; in the display "Pro2" will be appeared; now the reference value can be inputted by using be buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using be buttons; then push both buttons; in the display "of-5" will be appeared; accordingly the right and stable press. (see instance -0.2bar) must be fed. If the measured value shown in the display is a wrong value, the operati sequence must be retreated. Ear a position correction is necessary, if the installation position differs from the calibration position (otherwise this can cause a little deviation of the signal, which gives a wrong value indication)
	push both buttons; "oF I" will be appeared in the display; push both buttons; in the display "Pro2" will be appeared; now the reference value can be inputted by using buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using buttons; then push both buttons; in the display "oF5" will be appeared; accordingly the right and stable press. (see instance -0.2bar) must be fed. If the measured value shown in the display is a wrong value, the operatisequence must be retreated. Est a position correction is necessary, if the installation position differs from the calibration position (otherwise this can cause a little deviation of the signal, which gives a wrong value indication) Est the analogue output signal (for devices with analogue output) is not affected by this change;
CO _L	push both buttons; "or I" will be appeared in the display; push both buttons; in the display "Pro2" will be appeared; now the reference value can be inputted by using be buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using be buttons; then push both buttons; in the display of "of"s" will be appeared; accordingly the right and stable pressured value and the properties of the prope
FRet	push both buttons; "or I" will be appeared in the display; push both buttons; in the display "Pro2" will be appeared; now the reference value can be inputted by using be buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using be buttons; then push both buttons; in the display "oF5" will be appeared; accordingly the right and stable press (see instance -0.2bar) must be fed. If the measured value shown in the display is a wrong value, the operative sequence must be retreated. Esta position correction is necessary, if the installation position differs from the calibration position (otherwise this can cause a little deviation of the signal, which gives a wrong value indication) Esta the analogue output signal (for devices with analogue output) is not affected by this change; when displacing the offset, the full scale will also be displaced menu 37 – load defaults (only 4 20 ma 7.3-wire adjustable) to load the defaults, push both buttons simultaneously, after confirming the menu item
	push both buttons; "of FI will be appeared in the display; push both buttons; in the display "Pro2" will be appeared; now the reference value can be inputted by using bo buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using bo buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using bo buttons; then push both buttons; in the display "of-5" will be appeared; accordingly the right and stable pressu (see instance -0.2bar) must be fed. If the measured value shown in the display is a wrong value, the operating sequence must be retreated. EST a position correction is necessary, if the installation position differs from the calibration position (otherwise this can cause a little deviation of the signal, which gives a wrong value indication) EST the analogue output signal (for devices with analogue output) is not affected by this change; when displacing the offset, the full scale will also be displaced menu 37 - load defaults (only 4 20 ma /2 -wire adjustable) to load the defaults, push both buttons simultaneously, after confirming the menu item EST any changes carried out will be reset (password will be set on "0005")
FRat LoRd	push both buttons; "or I" will be appeared in the display; push both buttons; in the display "Pro2" will be appeared; push both buttons; in the display "o" will be appeared; now the reference value can be inputted by using be buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using be buttons; then push both buttons; in the display "o"F5" will be appeared; accordingly the right and stable pressu (see instance -0.2bar) must be fetd. If the measured value shown in the display is a wrong value, the operatic sequence must be retreated. E8" a position correction is necessary, if the installation position differs from the calibration position (otherwise this can cause a little deviation of the signal, which gives a wrong value indication) E8" the analogue output signal (for devices with analogue output) is not affected by this change; when displacing the offset, the full scale will also be displaced menu 37 – load defaults (only 4 20 mA / 3-wire adjustable) to load the defaults, push both buttons simultaneously, after confirming the menu item E8" any changes carried out will be reset (password will be set on "0005") menu 38 – load configuration (only 4 20 mA / 3-wire adjustable)
	push both buttons; "oF I" will be appeared in the display; push both buttons; in the display "Pro2" will be appeared; now the reference value can be inputted by using be buttons; the reference value is for instance 5% (-0.2bar) of metering range: 1 15 bar; insert 5 (5%) by using be buttons; then push both buttons; in the display "oF5" will be appeared; accordingly the right and stable press. (see instance -0.2bar) must be fed. If the measured value shown in the display is a wrong value, the operatis sequence must be retreated. Esta position correction is necessary, if the installation position differs from the calibration position (otherwise this can cause a little deviation of the signal, which gives a wrong value indication) Esta position correction is necessary, if the installation position differs from the calibration position (otherwise this can cause a little deviation of the signal, which gives a wrong value indication) Esta position correction (for devices with analogue output) is not defected by this change; when displacing the offset, the full scale will also be displaced menu 37 - load defaults (only 4 20 m 4 3-wire adjustable) to load the defaults, push both buttons simultaneously, after confirming the menu item Esta yn changes carried out will be reset (password will be set on "0005") menu 38 - load configuration (only 4 20 m A / 3-wire adjustable) to load a stored configuration (via menu 39), set the desired number 1 up to 5 menu 39 - load configuration (only 4 20 m A / 3-wire adjustable)
LoAd Skor special me	push both buttons; "or I" will be appeared in the display; push both buttons; in the display "Pro2" will be appeared; now the reference value can be inputted by using buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using buttons; then push both buttons; in the display "of-5" will be appeared; accordingly the right and stable press. (see instance -0.2bar) must be fed. If the measured value shown in the display is a wrong value, the operatisequence must be retreated. E\$\tilde{a}\tilde{a}\tilde{a}\tilde{b}\t
LoRd Short Special meters a	push both buttons; "of FI will be appeared in the display; push both buttons; in the display "Pro2" will be appeared; now the reference value can be inputted by using be buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using be buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using be buttons; then push both buttons; in the display "of-5" will be appeared; accordingly the right and stable pressu (see instance -0.2bar) must be fed. If the measured value shown in the display is a wrong value, the operatisequence must be retreated. E8" a position correction is necessary, if the installation position differs from the calibration position (otherwise this can cause a little deviation of the signal, which gives a wrong value indication) E8" the analogue output signal (for devices with analogue output) is not affected by this change; when displacing the offset, the till scale will also be displaced menu 37 - load defaults (only 4 20 mA / 3-wire adjustable) to load the defaults, push both buttons simultaneously, after confirming the menu item E8" any changes carried out will be reset (password will be set on "0005") menu 38 - load configuration (only 4 20 mA / 3-wire adjustable) to load a stored configuration (only 4 20 mA / 3-wire adjustable) to store a configuration (only 4 20 mA / 3-wire adjustable) to store a configuration, set the desired number 1 up to 5 mus
LoAd Skor special me	push both buttons; "or I" will be appeared in the display; push both buttons; in the display "Pro2" will be appeared; now the reference value can be inputted by using bo buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using bo buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using bo buttons; then push both buttons; in the display "of-5" will be appeared; accordingly the right and stable pressu (see instance -0.2bar) must be fed. If the measured value shown in the display is a wrong value, the operating a position correction is necessary, if the installation position differs from the calibration position (otherwise this can cause a little deviation of the signal, which gives a wrong value indication) Bath en analogue output signal (for devices with analogue output) is not affected by this change; when displacing the offset, the full scale will also be displaced menu 37 - load defaults (only 4 20 m/3 -3 wire adjustable) to load the defaults, push both buttons simultaneously, after confirming the menu item Bath en analogue carried out will be reset (password will be set on "0005") menu 38 - load configuration (only 4 20 m/3 -3 wire adjustable) to load a stored configuration (via menu 39), set the desired number 1 up to 5 menu 39 - store configuration (only 4 20 m/3 -3 wire adjustable) to store a configuration, set the desired number 1 up to 5 menu 93 - store configuration (only 4 20 m/3 -4 wire adjustable) to store a configuration with the desired number 1 up to 5 menu 93 - store configuration (only 4 20 m/4 -3 wire adjustable) to store a configuration with the desired number 1 up to 5 menu 93 - store configuration (only 4 20 m/4 -3 wire adjustable) to store a configuration with the desired number 1 up to 5 menu 94 - store configuration (only 4 20 m/4 -3 wire adjustable)
LoRd Short Special meters a	push both buttons; "or FI will be appeared in the display; push both buttons; in the display "Pro2" will be appeared; now the reference value can be inputted by using bo buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using bo buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using bo buttons; then push both buttons; in the display "of-5" will be appeared; accordingly the right and stable pressu (see instance -0.2bar) must be fed. If the measured value shown in the display is a wrong value, the operating sequence must be retreated. E\$\tilde{a}
LoRd Short Special meters a	push both buttons; "of F I will be appeared in the display; push both buttons; in the display "Pro2" will be appeared; now the reference value can be inputted by using be buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using be buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using be buttons; then push both buttons; in the display "of-5" will be appeared; accordingly the right and stable pressu (see instance -0.2bar) must be fed. If the measured value shown in the display is a wrong value, the operative sequence must be retreated. Ear position correction is necessary, if the installation position differs from the calibration position (otherwise this can cause at little deviation of the signal, which gives a wrong value indication) Ear the analogue output signal (for devices with analogue output) is not affected by this change; when displacing the offset, the full scale will also be displaced menu 37 – load defaults (only 4 20 mA / 3-wire adjustable) to load the defaults, push both buttons simultaneously, after confirming the menu item Ear any changes carried out will be reset (password will be set on "0005") menu 38 – load configuration (only 4 20 mA / 3-wire adjustable) to load a stored configuration (only 4 20 mA / 3-wire adjustable) to store a configuration (only 4 20 mA / 3-wire adjustable) to store a configuration (only 4 20 mA / 3-wire adjustable) to store a configuration (only 4 20 mA / 3-wire adjustable) to store a configuration (only 4 20 mA / 3-wire adjustable) to store a configuration, etc. the desired number 1 up to 5 menu 39 – store configuration (only 4 20 mA / 3-wire adjustable) to store a configuration, etc. the desired number 1 up to 5 menu 39 – store configuration (only 4 20 mA / 3-wire adjustable) to store a configuration, etc. the desired number 1 up to 5 menu 39 – store configuration (only 4 20 mA / 3-wire adjustable
LoRd Short Special meters a	push both buttons; "or FI will be appeared in the display; push both buttons; in the display "Pro2" will be appeared; now the reference value can be inputted by using bo buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using bo buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using bo buttons; then push both buttons; in the display "of-5" will be appeared; accordingly the right and stable pressu (see instance -0.2bar) must be fed. If the measured value shown in the display is a wrong value, the operating sequence must be refreated. E\$\tilde{\text{Si}}\text{ a position correction is necessary, if the installation position differs from the calibration position (otherwise this can cause a little deviation of the signal, which gives a wrong value indication) E\$\tilde{\text{Ti}}\text{ the analogue output signal (for devices with analogue output) is not affected by this change; when displacing the offset, the full scale will also be displaced menu 37 - load defaults (nnly 4 20 m A / 3-wire adjustable) to load the defaults, push both buttons simultaneously, after confirming the menu item E\$\tilde{\text{Ri}} any changes carried out will be reset (password will be set on "0005") menu 38 - load configuration (only 4 20 mA / 3-wire adjustable) to load a stored configuration (via menu 39), set the desired number 1 up to 5 menu 39 - store configuration (via menu 19), set the desired number 1 up to 5 menu 39 - store compensation is not the display in the indicated value for full scale differs from the real full scale use in the display of the measured value is within defined limits; set "0238"; confirm with both buttons; "Fs.5" will appear in the display; not it is necessary to place the device under pressure
LoRd Short Special meters a	push both buttons; "or I" will be appeared in the display; push both buttons; in the display "Pro2" will be appeared; now the reference value can be inputted by using bo buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using bo buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using bo buttons; then push both buttons; in the display "of-5" will be appeared; accordingly the right and stable pressu (see instance -0.2bar) must be fed. If the measured value shown in the display is a wrong value, the operating acquired the probability of th
LoAd Stor special me (to access a FS 5	push both buttons; "or I" will be appeared in the display; push both buttons; in the display "Prioz" will be appeared; now the reference value can be inputted by using be buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using be buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using be buttons; then push both buttons; in the display "of-5" will be appeared; accordingly the right and stable pressu (see instance -0.2bar) must be fed. If the measured value shown in the display is a wrong value, the operative sequence must be retreated. Eai' a position correction is necessary, if the installation position differs from the calibration position (otherwise this can cause a little deviation of the signal, which gives a wrong value indication) Eai' the analogue output signal (for devices with analogue output) is not affected by this change; when displacing the offset, the full scale will also be displaced menu 37 – load defaults (only 4 20 mA / 3-wire adjustable) to load the defaults, push both buttons simultaneously, after confirming the menu item Eai' any changes carried out will be reset (password will be set on "0005") menu 38 – load configuration (only 4 20 mA / 3-wire adjustable) to load a stored configuration (only 4 20 mA / 3-wire adjustable) to load a stored configuration (only 4 20 mA / 3-wire adjustable) to store a configuration (only 4 20 mA / 3-wire adjustable) to store a configuration (only 4 20 mA / 3-wire adjustable) to store a configuration (only 4 20 mA / 3-wire adjustable) to store a configuration (only 4 20 mA / 3-wire adjustable) to store a configuration, est the desired number 1 up to 5 menu 39 – store configuration (only 4 20 mA / 3-wire adjustable) to store a configuration, est the desired number 1 up to 5 menu 39 – store configuration (only 4 20 mA / 3-wire adjustable) to store a configuration, est the desired number 1 up
LoRd Short Special meters a	push both buttons; "or FI will be appeared in the display; push both buttons; in the display "Froz" will be appeared; now the reference value can be inputted by using be buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using be buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using be buttons; then push both buttons; in the display "of-5" will be appeared; accordingly the right and stable pressu (see instance -0.2bar) must be fed. If the measured value shown in the display is a wrong value, the operatis sequence must be retreated. EST a position correction is necessary, if the installation position differs from the calibration position (otherwise this can cause a little deviation of the signal, which gives a wrong value indication) EST the analogue output signal (for devices with analogue output) is not affected by this change; when displacing the offset, the full scale will also be displaced menu 37 - load defaults (only 4 20 m / 3-wire adjustable) to load the defaults, push both buttons simultaneously, after confirming the menu item EST any changes carried out will be reset (password will be set on "0005") menu 38 - load configuration (only 4 20 m / 3-wire adjustable) to load a stored configuration (via menu 39), set the desired number 1 up to 5 menu 39 - store configuration (via menu 39), set the desired number 1 up to 5 must a special menu, select the menu item "PAOf" with the A - or ▼-button and confirm it; "1" appears in the display) as pecial menu, select the menu item "PAOf" with the A - or ▼-button and confirm it; "1" appears in the display; now it is necessary to place the device under pressure (the pressure were to resource, if the deviation of the measured value is within defined limits; set 70:238"; confirm with both buttons; "FS S" will appear in the display; now it is necessary to place the device under pressure (the pressure must correspond to the end point of t
Land Star special me (to access s FS S	push both buttons; "or I" will be appeared in the display; push both buttons; in the display "Pro2" will be appeared; now the reference value can be inputted by using be buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using be buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using be buttons; then push both buttons; in the display "of-15" will be appeared; accordingly the right and stable pressu (see instance -0.2bar) must be fed. If the measured value shown in the display is a wrong value, the operative sequence must be retreated. Ear position correction is necessary, if the installation position differs from the calibration position (otherwise this can cause a little deviation of the signal, which gives a wrong value indication) Ear the analogue output signal (for devices with analogue output) is not affected by this change; when displacing the offset, the full scale will also be displaced menu 37 - load defaults; pointly 4 20 mA / 3-wire adjustable) to load the defaults, push both buttons simultaneously, after confirming the menu item Ear any changes carried out will be reset (password will be set on "0005") menu 38 - load configuration (only 4 20 mA / 3-wire adjustable) to load a stored configuration (via menu 39), set the desired number 1 up to 5 mus and the defaults, push the desired number 1 up to 5 mus application, set the desired number 1 up to 5 mus application, set the desired number 1 up to 5 mus application, set the desired number 1 up to 5 mus application, set the desired number 1 up to 5 mus application; a compensation which is necessary if the indicated value for full scale differs from the real full scale value in the application; a compensation which is necessary if the indicated value for full scale differs from the real full scale value in the application; a compensation in only possible with a respective reference source, if the deviation of the measured
LoAd Stor special me (to access a	push both buttons; "or I" will be appeared in the display; push both buttons; in the display "Pro2" will be appeared; now the reference value can be inputted by using bo buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using bo buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using bo buttons; then push both buttons; in the display "of-15" will be appeared; accordingly the right and stable pressu (see instance -0.2bar) must be fed. If the measured value shown in the display is a wrong value, the operating sequence must be retreated. E\(\textit{a}\)^2 a position correction is necessary, if the installation position differs from the calibration position (otherwise this can cause a little deviation of the signal, which gives a wrong value indication) E\(\textit{a}\)^2 he analogue output signal (for devices with analogue output) is not affected by this change; when displacing the offset, the full scale will also be displaced menu 37 - load defaults (only 4 20 m/3 -3 wire adjustable) to load the defaults, push both buttons simultaneously, after confirming the menu item E\(\textit{a}\)^2 any changes carried out will be reset (password will be set on "0005") menu 38 - load configuration (only 4 20 m/3 -3 wire adjustable) to load a stored configuration (only 4 20 m/3 -3 wire adjustable) to store a configuration, set the desired number 1 up to 5 menu 39 - store configuration (only 4 20 m/3 -3 wire adjustable) to store a configuration, set the desired number 1 up to 5 menu 39 - store configuration, which is necessary if the indicated value for full scale differs from the real full scale value in the application; a compensation is only possible with a respective reference source, if the deviation of the measured value is within defined limits; set "0.238"; confirm with both buttons; "FS S" will appear in the display; no it is necessary to place the device under pressure (the p
Land Star special me (to access s FS S	push both buttons; 'or E' will be appeared in the display; push both buttons; in the display "Pro2" will be appeared; now the reference value can be inputted by using bo buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using bo buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using bo buttons; then push both buttons; in the display 'oF5' will be appeared; accordingly the right and stable pressu (see instance -0.2bar) must be fed. If the measured value shown in the display is a wrong value, the operating sequence must be retreated. E\(\textit{E}\) a position correction is necessary, if the installation position differs from the calibration position (otherwise this can cause a little deviation of the signal, which gives a wrong value indication) E\(\textit{E}\) and a position correction is necessary, if the installation position differs from the calibration position (otherwise this can cause a little deviation of the signal, which gives a wrong value indication) E\(\textit{E}\) and a signal deviation of the signal, which gives a wrong value indication) E\(\textit{E}\) and a feature of the object of the properties
LoAd Stor special me (to access a	push both buttons; 'or E' will be appeared in the display; push both buttons; in the display "Pro2" will be appeared; now the reference value can be inputted by using bo buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using bo buttons; the reference value is for instance 5% (-0.2bar) of metering range: -1 15 bar; insert 5 (5%) by using bo buttons; the push both buttons; in the display "oF5" will be appeared; accordingly the right and stable pressu (see instance -0.2bar) must be fed. If the measured value shown in the display is a wrong value, the operative sequence must be retreated. Eii' a position correction is necessary, if the installation position differs from the calibration position (otherwise this can cause a little deviation of the signal, which gives a wrong value indication) Eii' the analogue output signal (for devices with analogue output) is not affected by this change; when displacing the offset, the full scale will also be displaced menu 37 - load defaults (only 4 20 m3 / 3-wire adjustable) to load the defaults, push both buttons simultaneously, after confirming the menu item Eii' any changes carried out will be reset (password will be set on "0005") menu 38 - load configuration (only 4 20 m3 / 3-wire adjustable) to load a stored configuration (only 4 20 m3 / 3-wire adjustable) to store a configuration (only 4 20 m3 / 3-wire adjustable) to store a configuration, set the desired number 1 up to 5 must special menu 1 - full scale compensation for full scale compensation which is necessary if the indicated value for full scale differs from the real full scale value in the application; a compensation is only possible with a respective reference source, if the deviation of the measured value is within defined limits; set "2023"; confirm with both buttons; "FS S" will appear in the display; now it is necessary to place the device under pressure (the pressure must correspond to the end point of the pressure measur

7 Placing out of service

⚠ WARNING! When dismantling the device, it must always be done in the depressurized and currentless. condition! Check also if the medium has to be drained off before dismantling!

⚠ WARNING! Depending on the medium, it may cause danger for the user. Comply therefore with adequate precautions for purification.

8. Maintenance

In principle, this device is maintenance-free. If desired, the housing of the device can be cleaned when switched of using a damp cloth and non-aggressive cleaning solutions.

With certain media, however, the diaphragm may be polluted or coated with deposit. It is recommended to define corresponding service intervals for control. After placing the device out of service correctly, the diaphragm can usually be cleaned carefully with a non-aggressive cleaning solution and a soft brush or sponge. If the diaphragm is calcified, it is recommended to send the device to BD SENSORS for decalcification. Please read therefore the chapter "Service/Repair" below

! An incorrect cleaning can cause irreparable damages on diaphragm. Never use spiky objects or pressured air for cleaning the diaphragm.

 
9 Service / Renair

9 1 Recalibration

During the life-time of the device, the value of offset and span may shift. As a consequence, a deviating signal value in reference to the nominal pressure range starting point or end point may be transmitted. If one of these two phenomena occurs after prolonged use, a recalibration is recommended to ensure furthermore high accuracy.

9.2 Return

Before every return of your device, whether for recalibration, decalcification, modifications or repair, it has to be cleaned carefully and packed shatter-proofed. You have to enclose a notice of return with detailed defect description when sending the device If your device came in contact with harmful substances, a declaration of decontamination is additionally required. Appropriate forms can be downloaded from our homepage www.bdsensors.com. Should you dispatch a device without a declaration of decontamination and if there are any doubts in our service department regarding the used medium, repair will not be started until an acceptable



10. Disposal

The device must be disposed according to the European Directives 2002/96/EG and 2003/108/EG (on waste electrical and electronic equipment). Waste of electrical and electronic equipment may not be disposed by domestic



⚠ WARNING! Depending on the measuring medium, deposit on the device may cause danger for the user and the environment. Comply with adequate precautions for purification and dispose of it properly.

11. Warranty conditions

The warranty conditions are subject to the legal warranty period of 24 months from the date of delivery. In case of improper use, modifications of or damages to the device, we do not accept warranty claims. Damaged diaphragms will also not be accepted. Furthermore, defects due to normal wear are not subject to warranty services.

12. Declaration of conformity / CE

The delivered device fulfils all legal requirements. The applied directives, harmonised standards and documents are listed in the EC declaration of conformity, which is available online at: http://www.bdsensors.com. Additionally, the operational safety is confirmed by the CE sign on the manufacturing label

DS2XX_E_240717